




3. Notes and Precautions

- **DO NOT** touch the connectors of the office dock.
- **DO NOT** attempt to make connections if there is any object between the computer and the office dock. Doing so could damage the computer and the office dock.
- **DO NOT** attempt to move the office dock when it is connected to the computer.
- If the computer malfunctions while the office dock is connected, turn off the computer and disconnect the office dock. Connect the AC adapter to the computer and check to see if the computer operates normally. If the computer operates normally, the office dock may be malfunctioning.
- **DO NOT** place metal objects or containers of liquid on top of the office dock. If paper clips, coins, or other metal objects, or water, or other liquid spills, get inside the office dock, fire or electric shock may result. Immediately unplug the power cable and remove the computer from the office dock.
- Unplug the power cord and remove the computer from the office dock if any of the following malfunctions occur:
 - the office dock is damaged
 - smoke is emitted
 - an unusual smell is emitted
 - the office dock is unusually hotContinuing to use the office dock while any of the above conditions are present may result in fire or electric shock.

Getac Contact Information

	Company name	Getac Technology GmbH.
	Address	Kanzlerstrasse 4 40472 Dusseldorf
	Phone	+49 (0) 211-984819-0

	Company name	Getac UK Ltd.
	Address	Getac House, Stafford Park 12, Telford, Shropshire, TF3 3BJ, UK
	Phone	+44 (0) 1952-207-222

	Company name	Getac Inc.
	Address	15495 Sand Canyon Rd., Suite 350 Irvine, CA 92618 USA
	Phone	+1-949-681-2900



Getac


F110

OFFICE DOCK OPERATION GUIDE

1. Introduction

The office dock duplicates most of your F110's ports and provides extra ports.

With peripheral devices such as a keyboard, mouse, monitor, and printer all connected to the office dock, you have a handy work area on your desk.

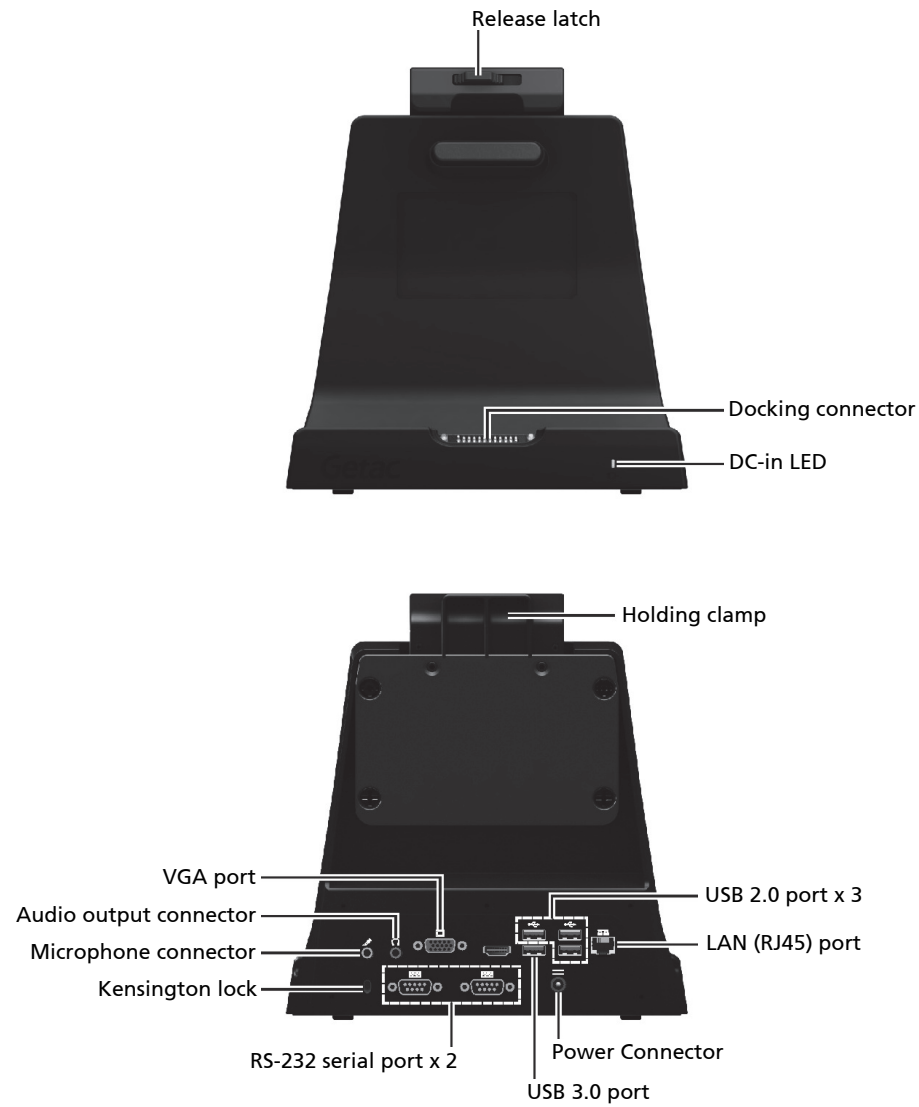

2. Installation

1. Push the release latch toward the right. The holding clamp will slide up slowly.



2. Align the connector and place F110 on the dock. Press down the holding clamp until it clicks into place.



3. Connect the cables of peripheral devices to the corresponding connectors on your office dock.
4. Connect the AC adapter to the office dock. The DC-in LED lights up.